

## CALIBRATION GUIDE Soldi Smart


### 2 versions (Non-SD and SD-Version with SD-slot in battery-compartment)

To perform a quick calibration of the Soldi Smart detector you will need the following items:

- Soldi Smart device
- Power adaptor of Soldi Smart
- An original pink calibration card

Please follow these steps to perform the quick calibration of the Soldi Smart:

1. Plug the Soldi Smart to the power supply by means of the adaptor.
2. Switch on the device normally by pressing the **ON/OFF** key and wait until it is ready and the green LED is on.
3. Push the **ON/OFF** key:  
Non-SD Soldi Smart = **4-6 times**  
SD-Version Soldi Smart = **3 times**  
until both green and red LEDs are on.
4. Feed the **pink** calibration paper four consecutive times. The device will take it and return it through the front.
5. Switch off the device by pressing the **ON/OFF** key. Both green and red LEDs are turned off.
6. Switch on the device and test if the performance has improved. If not, please contact your technical support.

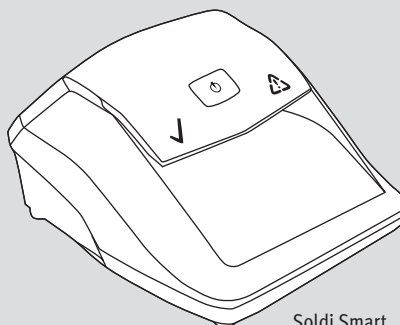

Soldi Smart